

C A M B R I D G E

SCALE WORKS, INC.

Model: SS660-OB Stainless Steel Floor Scale Series

(On-Board Junction Box)

Installation, Set-Up and Operation Manual



Made in USA

Cambridge Scale Works, Inc. • P.O. Box 670 • Honey Brook, PA. 19344

(800) 292-7640 • (610) 273-7040 • www.cambridgescale.com

Manual P/N: 5999-1062-00

Introduction

You have purchased the finest Stainless Steel Floor Scale on the market. It has been designed to give the customer many years of trouble free service. This scale was manufactured in the USA using the best steel, load cells, junction boxes and fabrication techniques to ensure a long life.

At some point your Cambridge Scale will require calibration and/or service. There are many qualified Cambridge service dealers/distributors across the United States to assist you. Thank you for purchasing a [product fully manufactured in the U.S.A.](#) by [Cambridge Scale Works, Inc.](#)

Service

If at any time you require assistance with your **Model: SS660-OB**

[End User](#) please contact your servicing scale dealer.

[Authorized Cambridge Dealer/ Distributor](#) please contact:

CAMBRIDGE SCALE WORKS, INC.

115 West Mary Street
Cumberland, MD 21502

Phone: (301) 724-4082


Fax: (301) 724-4964

Unpacking & Set Up Instructions

1. Before cutting the metal bands, inspect the skid for possible damage. If there is damage, notify the freight carrier and sign the freight bill noting possible damage to the skid or scale.
2. After the metal shipping bands are cut and protective packaging is removed from the base, insert (2) 1/2-13 eye bolts into the holes in the scale deck (eye bolts are not included). **Note:** Larger size and capacity scales may require 3/4-10 threaded eye bolts, as the scale weight increases.
3. Hook chain or cable to the eye bolts to lift the base from the skid. **Note:** Check to be sure that the chain or cable has sufficient lifting capacity for the scale weight.
4. The scale should be lifted approximately 12" (1 foot) off the floor. This will allow ample clearance to move the scale away from the skid or remove the skid from underneath the scale.
5. Move the base to its location/install site.
6. Locate the stainless steel leveling feet installed in each of the four corners. Turn each leveling foot down approximately 2-3 turns.
7. Lower the stainless steel floor scale into the location where the scale is to be used. Check the four corners to make sure the leveling feet are set solid to the floor. Adjust the leveling feet as required to level the scale.
8. With a wrench, wind the jam nut on the (4) leveling feet up to jam the nut to the load cell. This will keep the leveling foot from shifting.
9. Remove the eye bolts that were used to lower the scale into position.
10. Using an allen wrench, remove the (2) SS flat head socket cap screws holding the top access plate on. The indicator cable is underneath the top access plate. Run the cable underneath the scale so it will not be pinched when the top access plate is replaced. Replace the (2) SS flat head socket cap screws and re-tighten the plate to the scale deck. **NOTE:** DO NOT OVERTIGHTEN
11. Connect the base to the indicator by following the instructions in the indicator's service manual and scale base wiring diagram on the next page.

Scale Base Wiring Diagram


Scale Position: Right Side Up

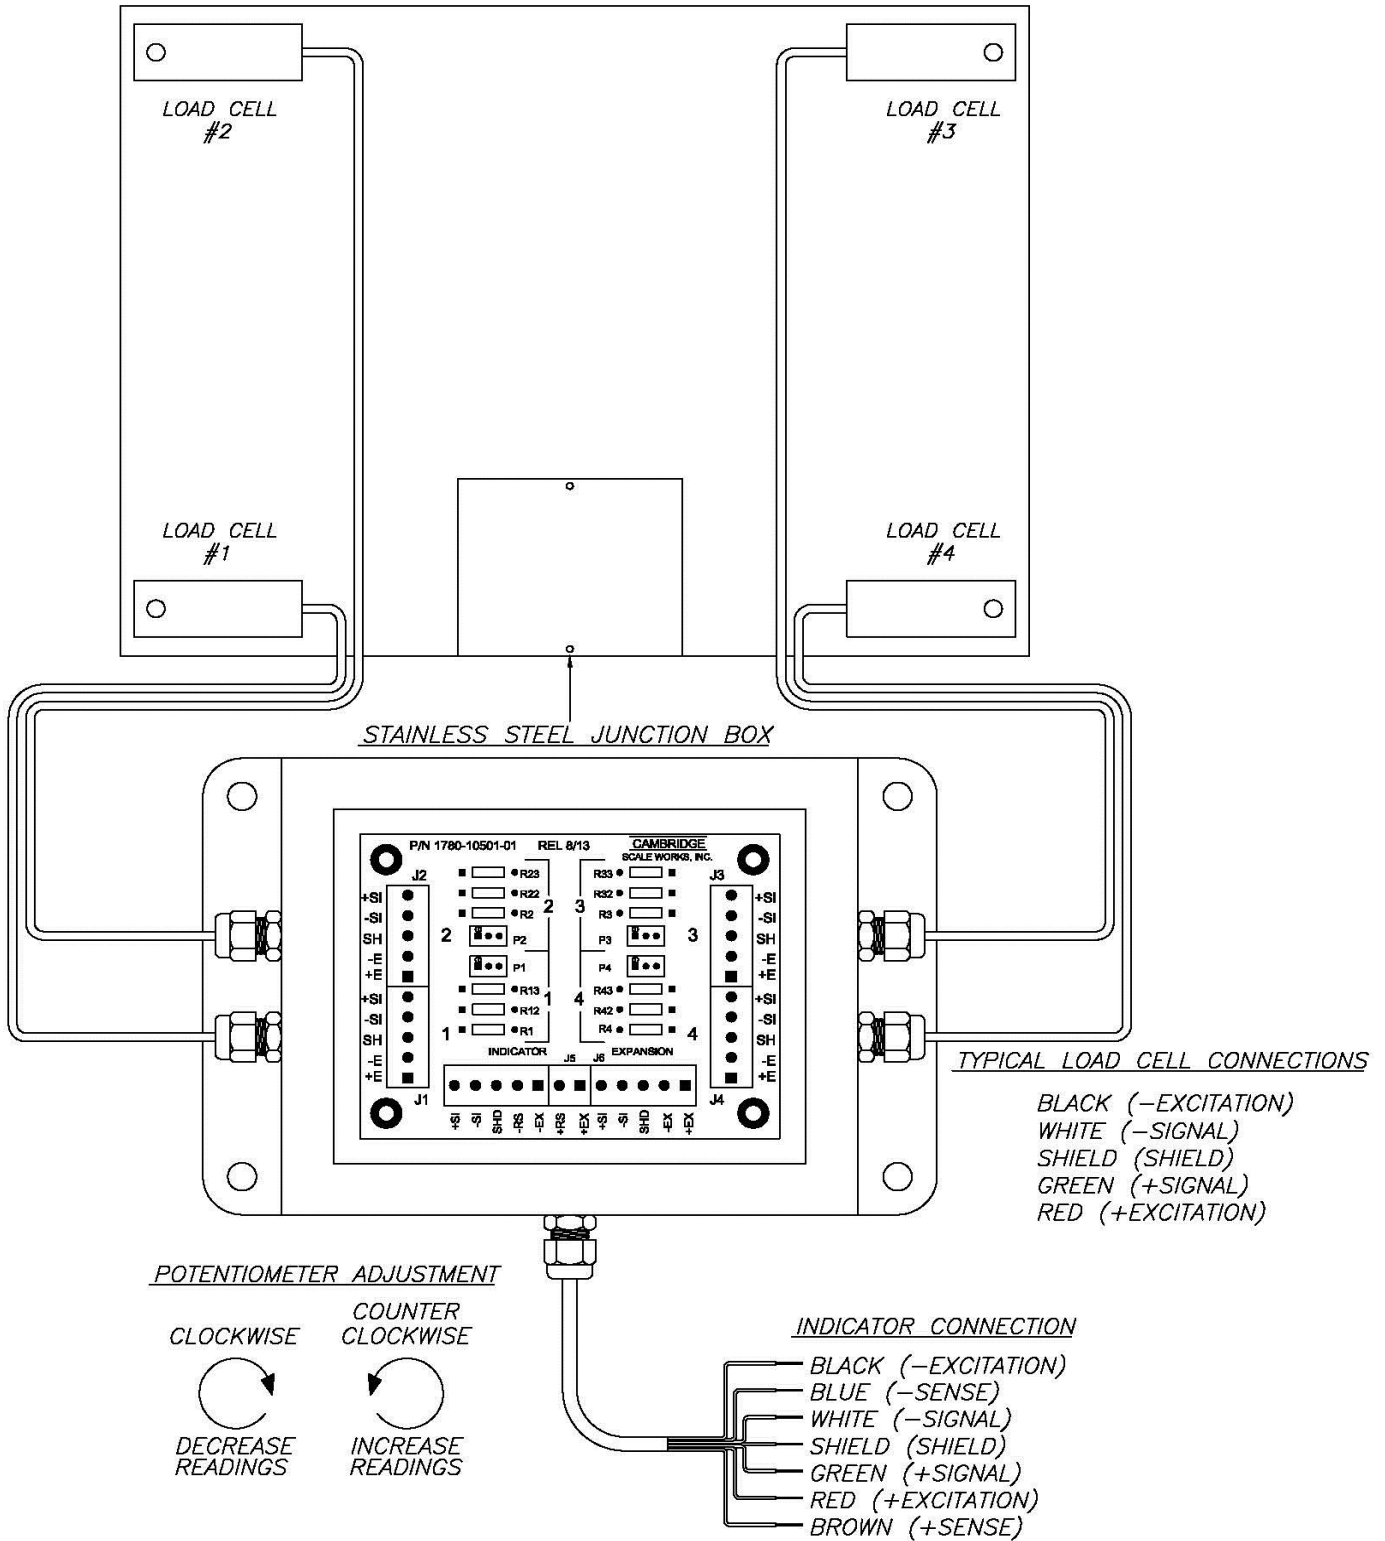

Ramp Installation

1. Set the height of the base to approximately 3 1/4" by adjusting the leveling feet up or down.
2. Insert (2) 1/2-13 eye bolts into the holes in the ramp deck. Hook the chain or cable to the eye bolts to lift and position the ramp. Position the ramp alongside the base with it off set approximately 6" to 8" (see illustration on following page).
3. Slide the ramp towards the base until the scale and ramp are approximately 1/4" to 1/2" apart.
4. Slide the ramp to the left until the horseshoes (ramp ears) hook around the leveling foot and the scale and ramp plates align.
5. Lastly, adjust the leveling feet so the scale and ramp are flush and all four corners are setting solid to the floor. Tighten the jam nuts on the leveling feet so they are snug against the load cell, but DO NOT OVERTIGHTEN. Although the scale cannot "walk" from the ramp with this unique design, it is strongly recommended that the ramp be lag bolted to the floor. (2) 1/2" lag down holes are provided, one on each side of the ramp.

Ramp Installation Illustration

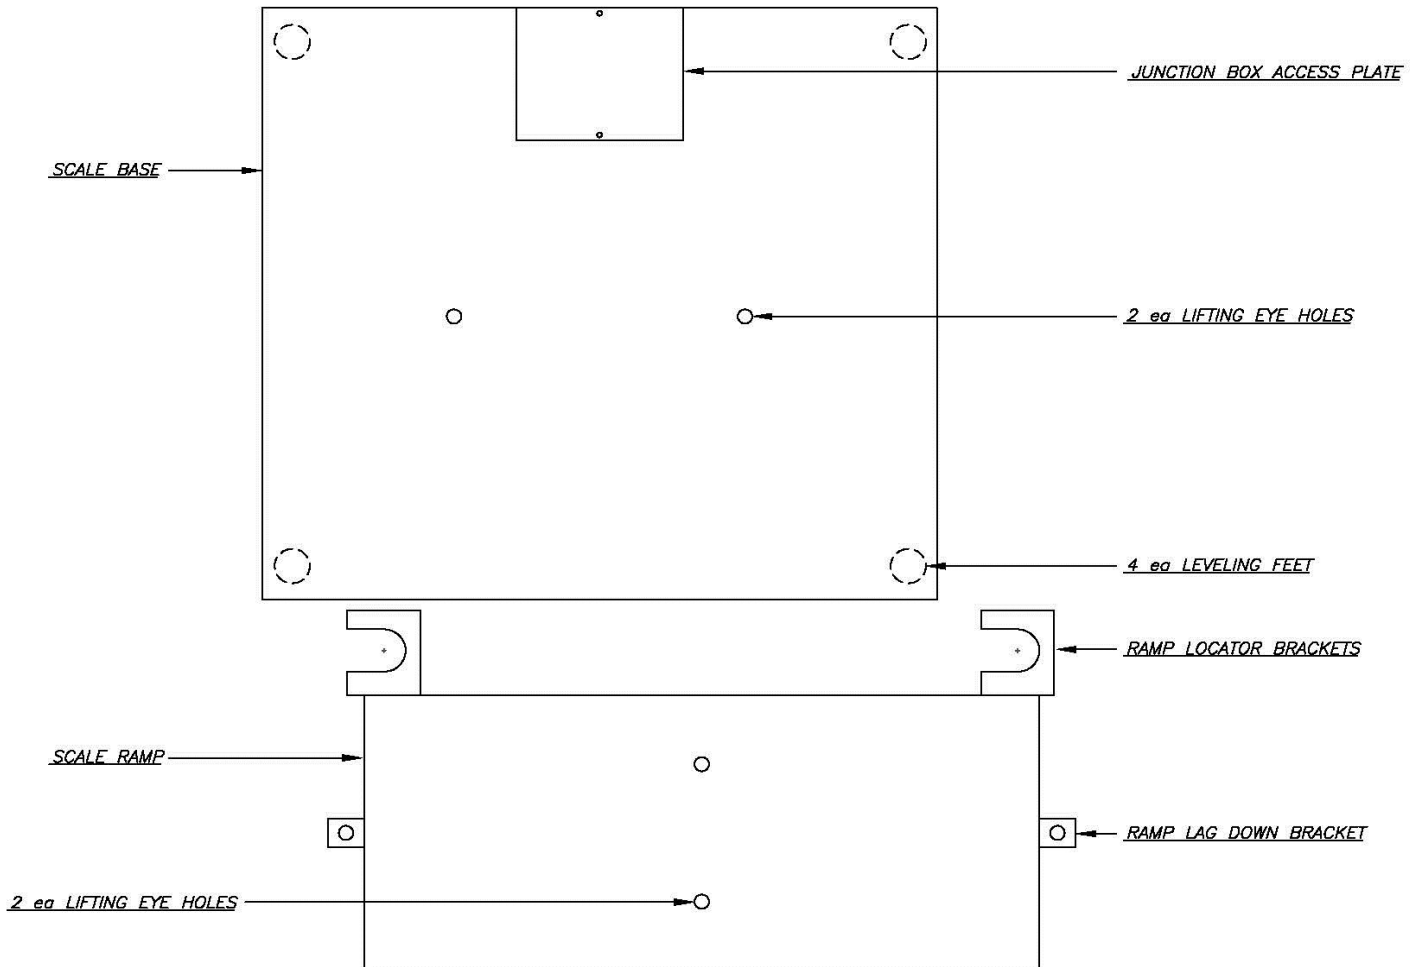

Corner Offset Adjustments

1. Remove the (2) SS flat head socket cap screws holding down the access plate.
2. Remove the (4) SS Screws holding the SS cover to the junction box.
3. Refer to the load cell wiring diagram (on page 4 of this manual) to locate the correct potentiometer to be adjusted.
4. After locating the correct potentiometer for the corresponding corner to be adjusted, turn the potentiometer screw clockwise to decrease the corner reading or counterclockwise to increase the corner reading.
NOTE: Adjusting one corner may have an effect on the other corners. After adjustment is complete, all corners should be rechecked to ensure accuracy.
5. Replace the SS cover on the junction box and replace the (4) SS screws.
NOTE: DO NOT OVERTIGHTEN
6. Recheck the scale with test weights & recalibrate if necessary.

Troubleshooting Tips

1. Check for a pinched off or damaged indicator cable.
2. Check to see if the indicator cable is correctly wired to the indicator.
3. Check that the (4) leveling feet are snug to the floor and that the base is adjusted to the correct height.
4. Check for any obstructions between the leveling feet and the load cells or between the load cells and the base framework. Also, check for obstructions between the scale frame and the floor.
5. Check for loose hardware on the load cell mounts.
6. Check for loose or damaged wires at the junction board.

Warranty Policy

CAMBRIDGE warrants the **SS660-OB** to be free of defects in workmanship and/or materials for 12 months from the date of shipment. This warranty of workmanship and/or materials is valid, if in the opinion of **CAMBRIDGE** the equipment has not been mechanically, environmentally, or electrically abused.

This warranty is limited, at the option of **CAMBRIDGE**, to repair, replace or an appropriate credit adjustment, not to exceed the original equipment sale price paid to **CAMBRIDGE**. **CAMBRIDGE** assumes no liability in connection with the sales of its products beyond that stated above.

Warranty replacement parts and or repair services are performed at the factory in Cumberland, Maryland or by an authorized service group approved by **CAMBRIDGE**.

Warranty does not include travel expense if a factory technician is requested to perform repairs at a location other than the factory.

It is the user's responsibility to follow the proper set-up, calibration and operating procedures of the **SS660-OB** as described in this manual. If the operator has difficulty using their **SS660-OB** properly, please contact **CAMBRIDGE** at 1-301-724-4082. Any one of our Technicians will be happy to work with the user via telephone.

Thank You!